


CITY OF BALTIMORE WET WEATHER CONSENT DECREE SMOKE AND DYED WATER TESTING FORM		Page 1 of 4
Sewershed: Low Level Subsewershed: 41	Company: REI/DRAYCO	Date: 08/05/2008
Test Type: Smoke	Ground Condition: Dry: X Damp: _ Wet: _	Supervisor: E.R. Crew: 04
Manhole ID: S21K1_022MH	Test ID: 1029-518	Notifications Made: __X__ Residents, Fire, 311
Field Sketch: (Show all manholes with numbers, blower placement location, sandbag or isolation locations, street names, building addresses and locations, defect locations and photograph numbers)		

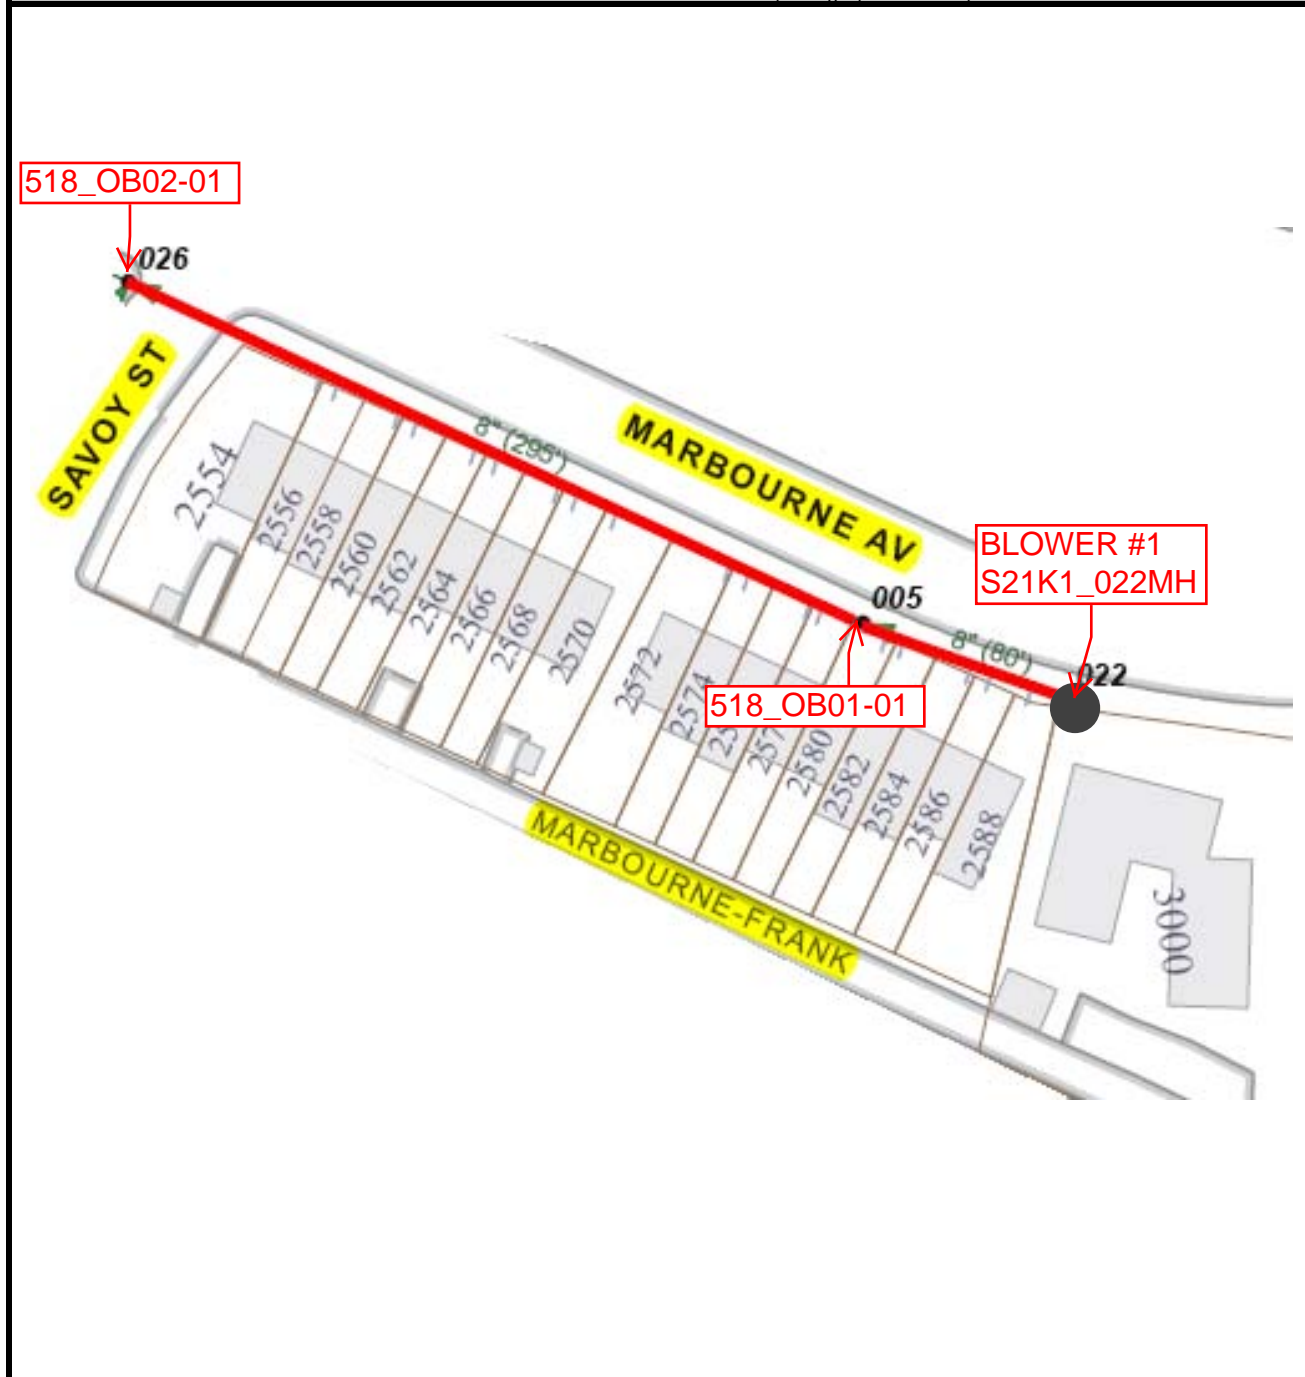

[illegible]

CITY OF BALTIMORE
SMOKE TESTING OBSERVATION SUMMARY
LOW LEVEL SEWERSHED
BALTIMORE CITY PROJECT 1029
REI/DRAYCO

Unique Test ID: 518	Date: 08/05/2008	Basin: LL - 41	Manhole ID: S21K1_022MH
Defect No: OB01	Supervisor: E.R.	Crew: 04	Dye Test Recommended: N
Location: S21K1_005MH			
Source Type: 10 MH Frame		Location: 05 Sidewalk	
Sector: 01 Public		Severity: 03 Moderate	Drainage Area: 6
Comments: SMOKE COMING FROM AROUND RIM OF S21K_005MH.			

SMOKE TEST PHOTOGRAPHS



Photograph No: OB01-01
Filename: 1029-518_OB01-01.jpg

CITY OF BALTIMORE
SMOKE TESTING OBSERVATION SUMMARY
LOW LEVEL SEWERSHED
BALTIMORE CITY PROJECT 1029
REI/DRAYCO

Unique Test ID: 518	Date: 08/05/2008	Basin: LL - 41	Manhole ID: S21K1_022MH
Defect No: OB02	Supervisor: E.R.	Crew: 04	Dye Test Recommended: N
Location: S21K1_026MH			
Source Type: 10 MH Frame		Location: 05 Sidewalk	
Sector: 01 Public		Severity: 03 Moderate	Drainage Area: 6
Comments: SMOKE COMING FROM AROUND RIM OF S21K_026MH.			

SMOKE TEST PHOTOGRAPHS



Photograph No: OB02-01
Filename: 1029-518_OB02-01.jpg